

# MONUMENT RECORD

Corner I.D. #


D-16

STATE OF INDIANA - COUNTY OF MONROE

Section Nineteen (19), Township 9 North, Range 1 East

Monument Description & Remarks: Stone found in bottomland at NW Corner of  
SE 1/4 of SE 1/4. Stone was triangular, 5" x 5", 3" exposed w/barbwire  
adjacent. Corner witnessed 1/11/90.

Recovery Tie Drawing

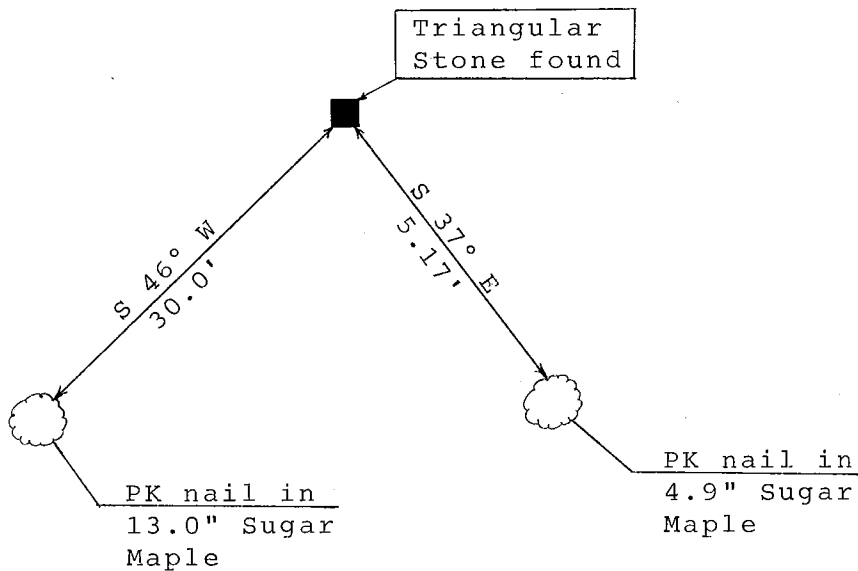

State of Indiana

County of Monroe

I, Michael W. Friley, County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 17-3-64-4 through 17-3-64-8 of the Indiana Code, being Acts of 1965, Chapter 319; and the above data is given under my hand and seal this 29th day of October, 1993 A.D.

Space Reserved For Recording Officer

Indiana Registered Land Surveyor No. \_\_\_\_\_ or

Morgan-Monroe State Forest  
United States Government Agency

David C. Vadas, Timber Specialist  
Title

Field Book:

n/a

Page:

n/a

## SECTION 19, T 9 N, R 1 E

1. On 4-9-87, I reconned the south line at the request of Frank Ballentyne, Asst. State Surveyor for an ongoing survey (C16 T11, 12). I located a large stone with a + on it at the SW corner of SW $\frac{1}{4}$ , SE $\frac{1}{4}$ . Fence wire ran N, E, W from the stone. I flagged a line in red flagging E  $\frac{1}{4}$  mile, but failed to locate a corner marker of any type. Someone else had run E & W from stone in orange flagging.

*David Vadas*

David Vadas, Timber Specialist

*field  
check  
have  
m. 2 x at  
30 tied*

2. On 1/9/90 I flagged the N, W, & S lines of the portion (19.5 acres) of the N $\frac{1}{2}$ , SE $\frac{1}{4}$ , SE $\frac{1}{4}$ , of this section. A fence line existed along the north line which was deemed to be good at the NW & NE corners but the fence meandered somewhat inbetween. A possible stone was found at the NW corner of the SE $\frac{1}{4}$ , SE $\frac{1}{4}$ , as it was located along the fenceline in a position consistent with the Topographic map. Fencewire went right next to it, but there was no mark or cross on it, however it was pointed. A line was flagged south of this stone to a 12" shagbark hickory that had old orange paint on it. This presumably was done when the lines were run back about 1977 for the adjacent landowner by Bill Bull. Portions of old flagging were found along the W and S lines (blue flagging) which agreed substantially with the Stone found at the NW corner and the Black oak tree with wire at the SE corner of the N $\frac{1}{2}$ , SE $\frac{1}{4}$ , SE $\frac{1}{4}$ . The W line had only a minor adjustment to the SHH tree, while the south line had an adjustment of 8 p N in 236 paces west from the Black oak tree. A fence line exists along the E line of the S $\frac{1}{2}$ , SE $\frac{1}{4}$ , SE $\frac{1}{4}$ . An active encroachment was found at the NE corner of the S $\frac{1}{2}$ , SE $\frac{1}{4}$ , SE $\frac{1}{4}$  which consisted of trees cut across the line by loggers working on the adjacent David C. Vadas, Timber Specialist Flick property. Summary yet to be compiled.

3. On 1/11/90 I painted in and posted the following lines: The N, W, and S lines of defining the portion of private property in the N $\frac{1}{2}$ , SE $\frac{1}{4}$ , SE $\frac{1}{4}$ . There were 15 trees with volume removed the Graber Logging crew and Bill Hahn and I tallied these as to species and height measurements. An encroachment preliminary report is being sent to the Central Office. A stone? found in the bottomland at the NW corner of the SE $\frac{1}{4}$ , SE $\frac{1}{4}$ , was witnessed as follows:

Stone, triangular in shape, roughly 5" by 5" exposed 3" with barbwire adjacent.

04.9" SUM 5'2" at 143° 53' 37" E 11:36 am, clear, windy, 40°; measurements from Stone  
13.0" SUM 30'0" at 226° 54' 10" W to PK nail w/pink flagging in base of tree.

Also, after the line was painted in, Bill Hahn uncovered what may be the stone for the NE corner of the SE $\frac{1}{4}$ , SE $\frac{1}{4}$ . This stone was broken however, but was in the correct location according to the fences and treelines. Boundary signs were placed at about every 40-50 paces along the line or where ridgetop roads or ravines crossed the line. Also, I flagged the E line of the S $\frac{1}{2}$ , of the SE $\frac{1}{4}$ , SE $\frac{1}{4}$ . The adjustment was 3/4 p E David C. Vadas, Timber Specialist in 100 p N from the Stone at the SE section corner.

4. On 1/24/90 I witnessed the stone at the SE corner of this section and painted in the E line of the state portion in the S $\frac{1}{2}$  of the SE $\frac{1}{4}$ , SE $\frac{1}{4}$ . A SFP was driven next to the stone. I flagged the line from the SE section quarter west to the S $\frac{1}{2}$  mile (a stone) and the adjustment was 2 $\frac{1}{4}$  paces north in 452 paces west. This was split in half to determine the SE corner of the SW $\frac{1}{4}$ , SE $\frac{1}{4}$ . No evidence of a stone was found however a

PAGE (3 ?) MISSING

*drawn  
10-27-93  
field  
check  
field  
check*